

MSDS - Material Safety Data Sheet

Product Name: Janton Video Display Terminal Cleaner

MSDS No.: 143


I. Basic Information:

Manufacturer: Claire Mfg
Address: 500 Vista Ave
City, ST Zip: Addison, IL 60101

Last Update:

Chemical State: Liquid Gas Solid

Chemical Type: Pure Mixture

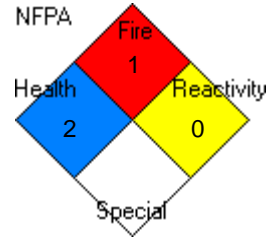

2	Health
1	Flammability
0	Reactivity
	Pers. Protection

II. Ingredients:

CAS No.	Chemical Name	% Range	EHS	NTP	IARC	SARA SUB Z 313	OSHA PEL	ACGIH TLV	Other Limits
111762	2- Butoxyethanol	3.9							
64175	Ethyl alcohol	10-20							
0	Hydrocarbon gas, liquefied and nonliquefied	1-5							
67561	Methyl alcohol	.8							

III. Hazardous Identification:

Hazard Category:

Acute Chronic Fire Pressure Reactive

Hazardous Identification Information:

This oproduct contains 2-Butoxyethanol, which has caused liver and kidney damage and hemolytic anemica in test animals.

IV. First Aid Measures:

Route(s) of Entry:

Inhalation, skin, ingestion.

Health Hazards (Acute and Chronic):

This product contains 2-Butoxyethanol, which has caused liver and kidney damage and hemolytic anemia in test animals.

Signs and Symptoms:

Respiratory irritation. High concentrations may produce headache, dizziness, and nausea. Prolonged or repeated skin contact may lead to drying, irritation and dermatitis. Possible skin absorption. Eye contact may cause burning and irritation. This product contains 2-Butoxyethanol, which has caused kidney damage and hemolytic anemia in test animals.

Medical Conditions Generally Aggravated by Exposure:

None known.

Emergency and First Aid Procedures:

MSDS - Material Safety Data Sheet

Product Name: *Janton Video Display Terminal Cleaner*

MSDS No.: 143

INHALATION-Move victim to fresh air and restore breathing if necessary. Stay with victim until arrival of emergency medical personnel. SKIN-Remove contaminated clothing and wash skin with plenty of water. If irritation persists, seek medical attention. Wash clothing before reuse. Eye, immediately flush with water for 15 minutes while holding eyelids open. Get prompt medical attention. INGESTION-Contact local poison control center or physician immediately.

Other Health Warnings:

NA

V. Fire Fighting Measures:

Flash Point: Not Est **Lower Explosive Limit:** 1.8% **Upper Explosive Limit:** 9.2%

Fire Extinguishing Media: Carbon dioxide, dry chemical or foam.

Special Fire Fighting Procedures:

Containers should be cooled with water to prevent vapor pressure build up. Use equipment or shielding as required, to protect personnel from bursting, rupturing or venting containers.

Unusual Fire and Explosion:

Do not spray near open flame or while smoking. At elevated temperatures over (54C/130F), containers may vent, rupture, or burst.

VI. Accidental Release Measures:

Steps to be Taken in Case Material is Released or Spilled:

Remove all sources of ignition and ventilate area. Soak up spill with an inert absorbent and place into a designated disposal container. Consult local regulatory agency for proper disposition of material.

VII. Handling and Storage:

Precautions to be Taken:

Avoid breathing vapor. Keep away from heat and flame. Use with adequate ventilation. Do not puncture or incinerate containers.

Other Precautions:

Please read and follow the directions on the product label. They are your best guide to using this product in the most effective way, and give the necessary safety precautions to protect your health.

VIII. Exposure Controls/Personal Protection:

Ventilation Requirements:

Local exhaust adequate under normal conditions. Mechanical exhaust optional.

Personal Protective Equipment:

Gloves-Chemical resistant gloves.

Eye Protection-Chemical safety glasses.

Other Protective Clothing or Equipment-Wear impervious clothing to prevent skin contact.

Work/Hygienic Practices-Ensure strict sanitary conditions are conformed to when working around chemicals. Protective clothing and equipment in accordance with 29CFR 1910.132 and CFR 1910.133.

MSDS - Material Safety Data Sheet

Product Name: Janton Video Display Terminal Cleaner

MSDS No.: 143

Distributed by: The Janton Company 1288 N. High St. Columbus, Ohio 43201
G&L Supply Company 139 N. Diamond St. Mansfield, Ohio 44902

EMERGENCY TELPHONE NO 419-524-5112